
# Data Sheet | Item Number: 2006-991

End plate for fuse terminal blocks; 2 mm thick; gray

https://www.wago.com/2006-991

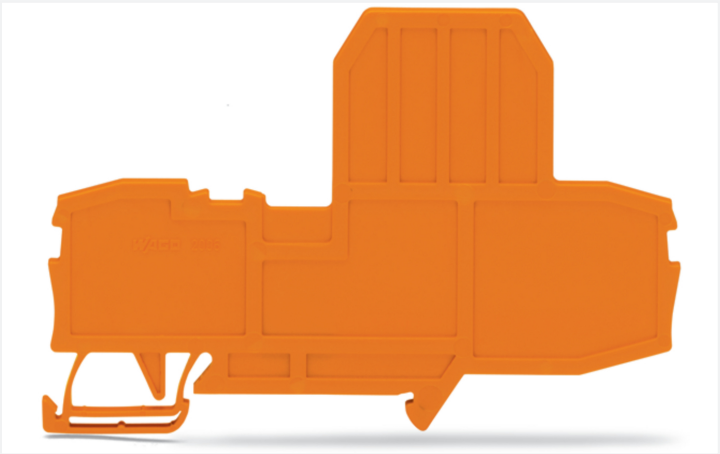

Color: gray

Similar to illustration

## Physical data

| | |
|---|---|
| Width | 2 mm / 0.079 inches |
| Height | 95.8 mm / 3.772 inches |
| Depth from upper-edge of DIN-rail | 59 mm / 2.323 inches |

## Mechanical data

| | |
|---|---|
| Mounting type | snap-on type |

## Material data

| | |
|---|---|
| Note (material data) | Information on material specifications can be found here |
| Color | gray |
| Material group | I |
| Insulation material (main housing) | Polyamide (PA66) |
| Flammability class per UL94 | V0 |
| Fire load | 0.148 MJ |
| Weight | 5.4 g |

## Environmental requirements

### Environmental Testing

| | |
|---|---|
| Test specification:<br>Railway applications –<br>Rolling stock –<br>Electronic equipment | DIN EN 50155 (VDE 0115-200):2022-06 |
| Test procedure:<br>Railway applications –<br>Rolling stock equipment –<br>Vibration and shock tests | DIN EN 61373 (VDE 0115-0106):2011-04 |
| Spectrum/Mounting location | Service life test, Category 1, Class A/B |
| Functional test with noise-like oscillations | Test passed according to Section 8 of the standard |
| Frequency | $f_1 = 5$ Hz to $f_2 = 150$ Hz |

### Environmental Testing

| | |
|---|---|
| Acceleration | 0.101g (highest test level used for all axes) |
| Test duration per axis | 10 min. |
| Test directions | X, Y and Z axes |
| Monitoring of contact faults and interruptions | Passed |
| Voltage drop measurement before and after each axis | Passed |
| Simulated service life test through increased levels of noise-like oscillations | Test passed according to Section 9 of the standard |
| Frequency | $f_1 = 5$ Hz to $f_2 = 150$ Hz |
| Acceleration | 0.572g (highest test level used for all axes) |


Continued on next page

## Environmental Testing

| | |
|---|---|
| Test duration per axis | 5 h |
| Test directions | X, Y and Z axes |
| Extended testing: Monitoring of contact faults and interruptions | Passed |
| Extended testing: Voltage drop measurement before and after each axis | Passed |
| Shock test | Test passed according to Section 10 of the standard |
| Shock pulse form | Half sine |
| Acceleration | 5g (highest test level used for all axes) |
| Shock duration | 30 ms |
| Number of shocks (per axis) | 3 pos. und 3 neg. |
| Test directions | X, Y and Z axes |
| Extended testing: Monitoring of contact faults and interruptions | Passed |
| Extended testing: Voltage drop measurement before and after each axis | Passed |
| Vibration and shock stress for rolling stock equipment | Passed |

## Commercial data

| | |
|---|---|
| Product Group | 22 (TOPJOB S) |
| PU (SPU) | 100 (25) pcs |
| Packaging type | Box |
| Country of origin | DE |
| GTIN | 4045454892982 |
| Customs tariff number | 85389099990 |

## Product Classification

| | |
|---|---|
| UNSPSC | 39121410 |
| eCl@ss 10.0 | 27-14-11-33 |
| eCl@ss 9.0 | 27-14-11-33 |
| ETIM 9.0 | EC000886 |
| ETIM 10.0 | EC000886 |
| ECCN | NO US CLASSIFICATION |

## Environmental Product Compliance

| | |
|---|---|
| RoHS Compliance Status | Compliant,No Exemption |

## Approvals / Certificates

### Declarations of conformity and manufacturer's declarations

| Approval | Standard | Certificate Name |
|---|---|---|
| Railway<br>WAGO GmbH & Co. KG | - | Railway Ready |


Continued on next page

## Downloads

### Environmental Product Compliance

**Compliance Search**

Environmental Product Compliance 2006-991

### Documentation

**Bid Text**

| | | | |
|---|---|---|---|
| 2006-991 | 28.04.2017 | doc 23.50 KB | |
| 2006-991 | 19.02.2019 | xml 2.51 KB | |

### CAD/CAE-Data

**CAD data**

2D/3D Models 2006-991

**CAE data**

EPLAN Data Portal 2006-991

WSCAD Universe 2006-991

ZUKEN Portal 2006-991